




## Smoke and Dye-Water Observation Summary

### Western Run Pilot Project - Baltimore Maryland

#### FIELD SKETCH

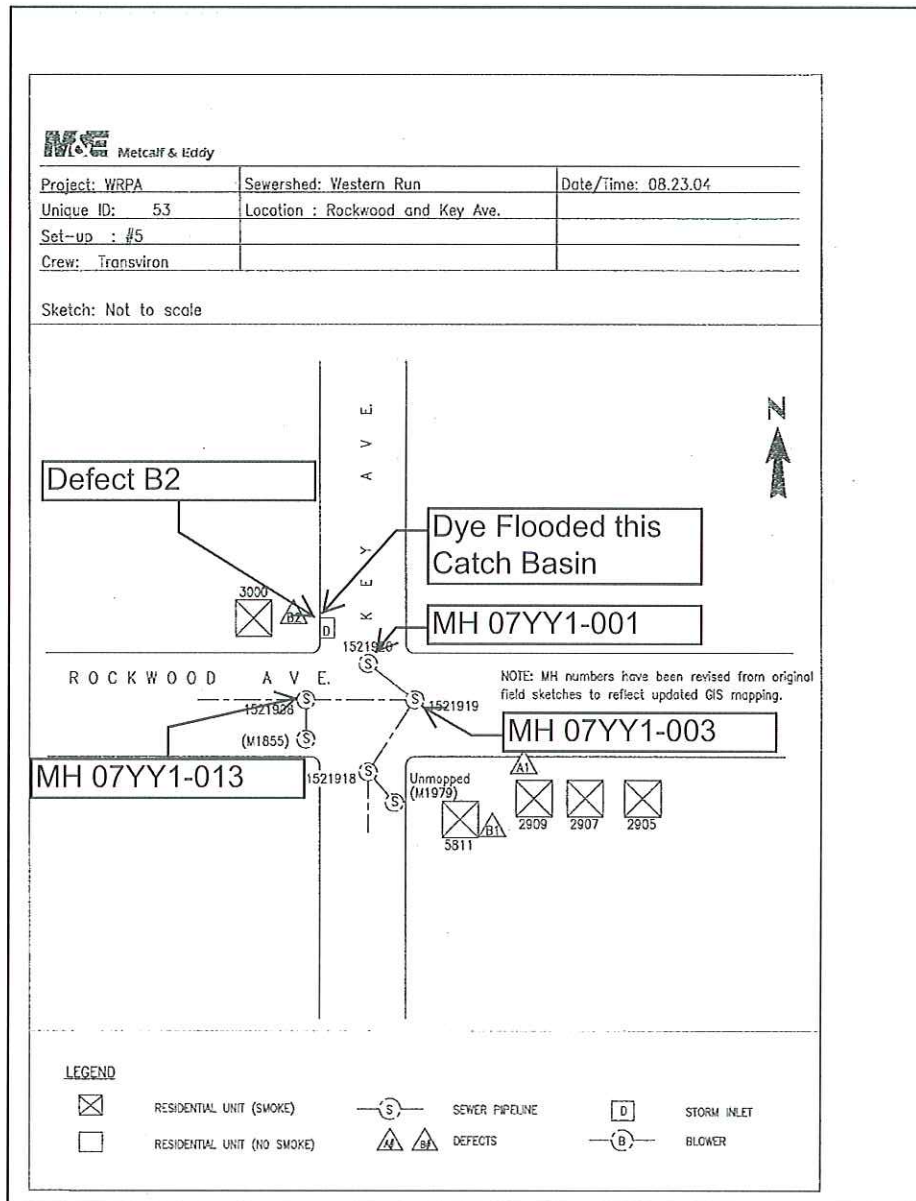

Sketch No: 53

#### Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\53.tif


Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.

# DYE TESTING FORM

Sketch (NTS)  
Dye Test 53

Show North Arrow

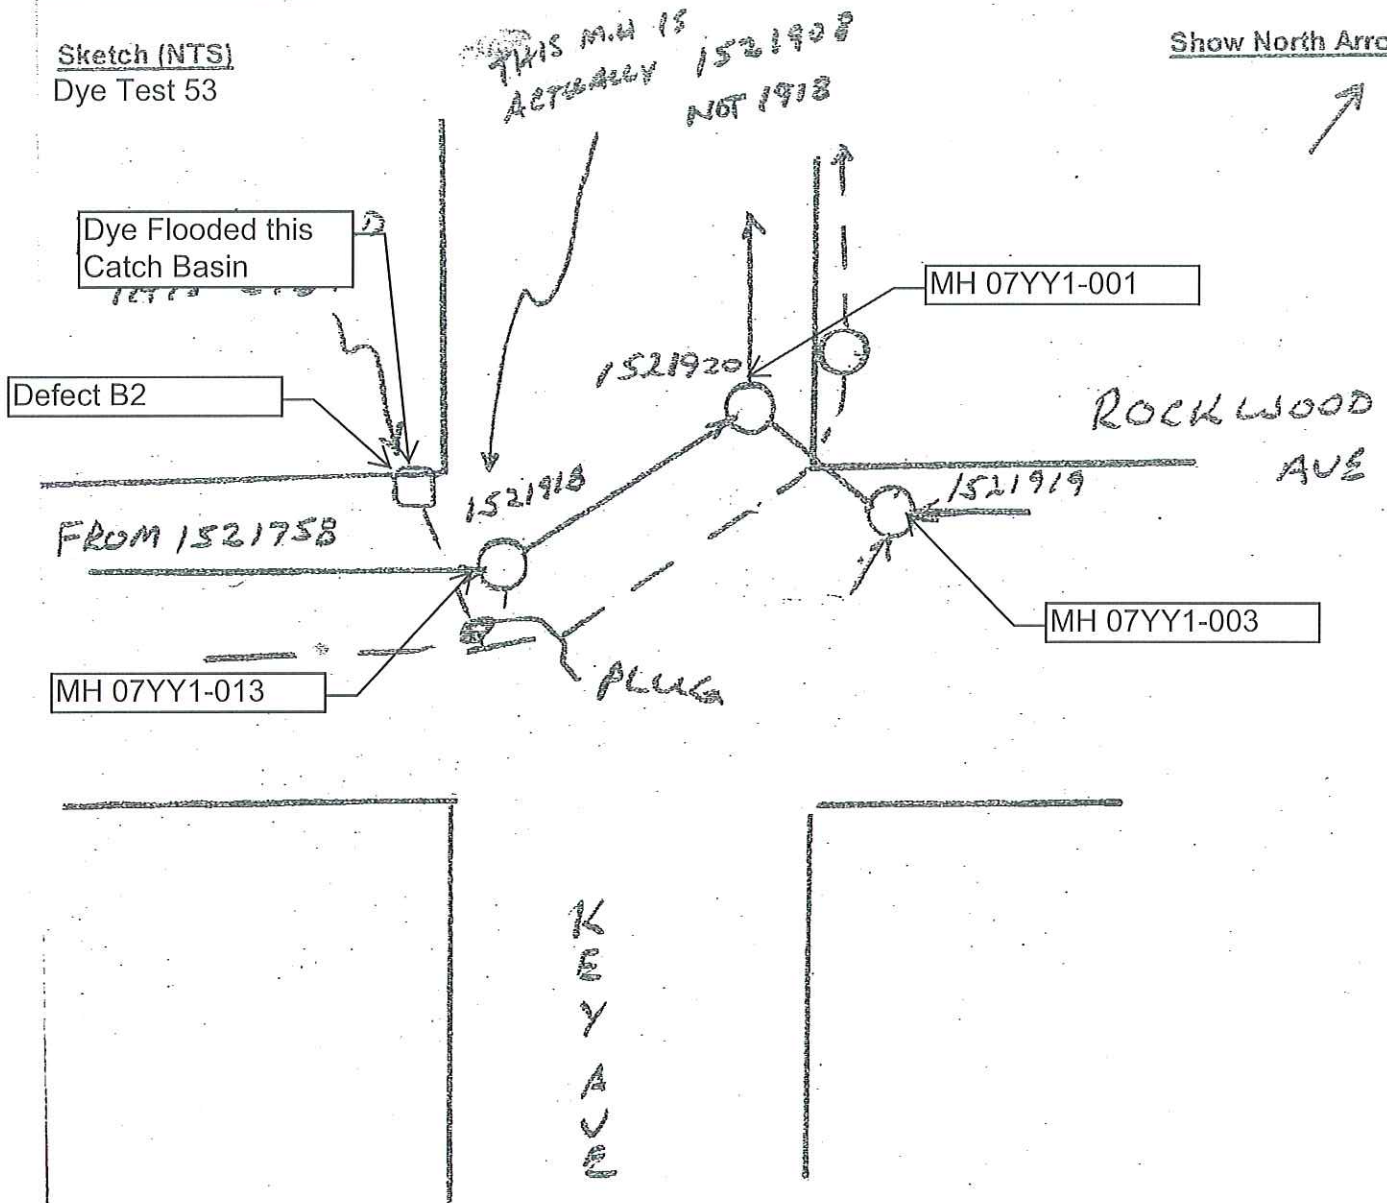

RESULT CODES	SOURCE TYPE CODES			
1. POSITIVE	1. MAIN SEWER	5. DOWN SPOUT	9. STAIRWELL DRAI	13. STORM DRAIN
2. NEGATIVE	2. SERVICE LINE	6. DWNSTPT CONN.	10. FOUNDATION DRAIN	14. CATCH BASIN
3. CANNOT TEST	3. TRANSITION JOIN	7. AREA DRAIN	11. BUILDING INTERIOR	15. STORM MH
	4. CLEAN OUT	8. DRIVEWAY DRAIN	12. MH FRAME/SEAL	16. STORM DITCH

Additional Comments: CAMERA WAS UNDER FLOW FOR MOST OF THE TIME, BUT COULD SEE JOINTS.  
KEPT M.H. #S CONSISTANT WITH SMOKE TEST SKETCH BUT SMOKE TEST SKETCH WAS WRONG.  
N.K.


## INSPECTION REPORT

DATE: 04/06/2005	WORK ORDER:	WEATHER: SUNNY, DRY	OPERATOR: J.A.M.	SECTION NR: 30	SECTION NAME:
PRESENT:	VEHICLE: TV 175	CAMERA: PAN/TILT	PRESET:	CLEANED: NO	RATE: 220

STREET: ROCKWOOD AVE. 53 B 2	MAP #1: 2	MH: 1521918
CITY: BALTIMORE	MAP #2:	MH: 1521758
LOCALE: SMALL RESIDENTIAL STREET	TAPE #: JAM 2	TV'D LGTH: 15.8 ft

INSPECT REASON: DYE TESTING	PIPE SIZE: 8 in
SECTION TYPE: WASTEWATER	MATERIAL: VCP JT LGTH: 3 ft
AREA: 01-WR20	LINING: NO RELINING
	RSRVD:

REMARK: DYE TEST 53 B 2 /THE C.B. FLOODED WELL. RECEDED APROX. 3 GPM

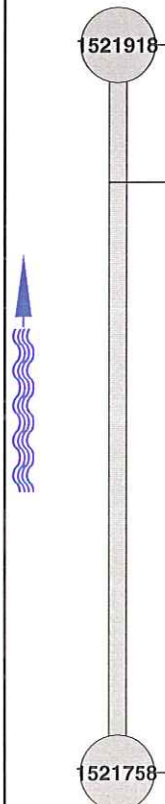1:50	DIST	OBSERVATION	RATE	VCR #	PH
	0.00	inspection begins at downstream manhole, 1521918 (1521908) ?		00:43:19	
	3.00	Infiltration Seeping at joint at 11 o'clock	2	00:49:34	46a
	15.80	inspection ends, CAMERA UNDER FLOW. NO MORE LEAKS SEEN AT JOINTS		00:49:34	

## INSPECTION IMAGES

CITY:  
**BALTIMORE**

STREET:  
**ROCKWOOD AVE. 53 B 2**

DATE:  
**04/06/2005**

SECTION NR:  
**30**

SECTION NAME:



IMAGE: 46a, TAPE #: JAM 2, 00:49:34  
3FT, Infiltration Seeping at joint at 11 o'clock